

XS1100H/LH/SH

DRIVE AXLE BEARING COLLAR



A new-style bearing supports the right-hand side of the transmission drive axle on the affected models. This new-style bearing is a single-row ball bearing rather than a double-row bearing as used in previous XS11s. Since the new-style bearing is 3mm narrower than the bearing previously used, a collar has been installed between the bearing and the crankcase to maintain the proper clearances in the transmission. This collar is directional; it must be installed with the beveled edge toward the crankcase and away from the bearing.

CAUTION:

If the collar is positioned improperly during assembly, the crankcase will be damaged when the drive axle bearing is installed. Be sure the bearing collar is installed correctly before pressing the drive-axle bearing into the crankcase.

AFFECTED MODELS

All XS1100H, XS1100LH, and XS1100SH

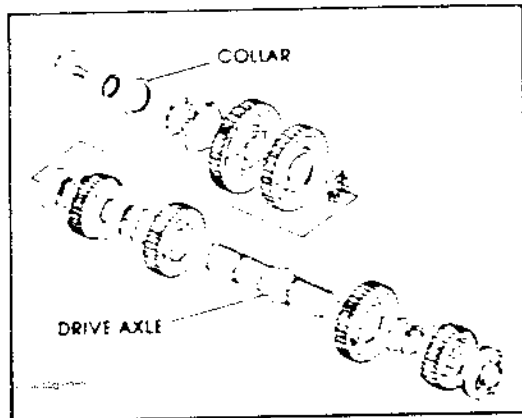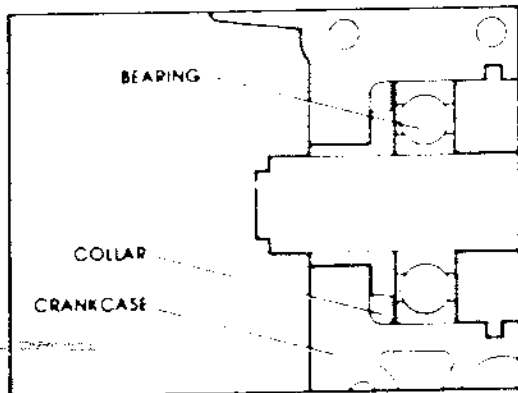

PARTS INFORMATION

PART NUMBER	DESCRIPTION	REMARKS	DEALER COST
93306-20533-00	Bearing	New-style	
90387-443A8-00	Collar		